

FEMA 339 / March 1999



Building Performance Assessment Report

Hurricane Georges In Puerto Rico

**Observations,
Recommendations,
and Technical Guidance**




Federal Emergency Management Agency
Mitigation Directorate
Washington, DC,
Region II, New York, NY
and the Caribbean Area Office



IMAGE COURTESY NASA

The Building Performance Assessment Process

In response to hurricanes, floods, earthquakes, and other disasters, the Federal Emergency Management Agency (FEMA) often deploys Building Performance Assessment Teams (BPATs) to conduct field investigations at disaster sites. The members of a BPAT include representatives of public and private sector entities who are experts in specific technical fields such as structural and civil engineering, building design and construction, and building code development and enforcement. BPATs inspect disaster-induced damages incurred by residential and commercial buildings and other manmade structures; evaluate local design practices, construction methods and materials, building codes, and building inspection and code enforcement processes; and make recommendations regarding design, construction, and code issues. With the goal of reducing the damage caused by future disasters, the BPAT process is an important part of FEMA's hazard mitigation activities. For more information about the BPAT program or if you are interested in becoming a member, please visit our website at www.fema.gov/mit/bpat.

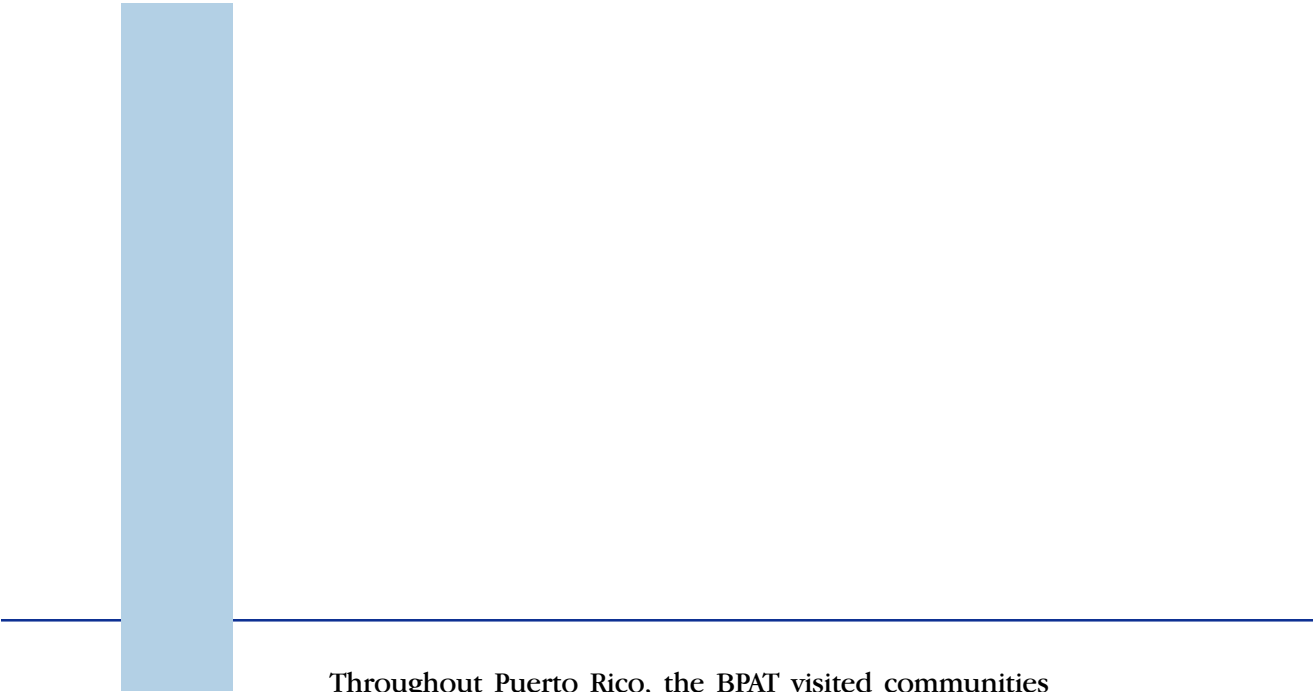

Throughout Puerto Rico, the BPAT visited communities where people had lost their life's belongings and literally did not have a roof over their heads. The team was struck by the dignity of those individuals who had suffered great losses and appreciated the courtesy and hospitality that was extended to them. The team also appreciated their patience with the BPAT's questions. This report is dedicated to these individuals, their families, and their friends. Their remarkable spirit is summarized by the saying "*al mal tiempo, buena cara*", which translates as "hard times, strong faces".

Building Performance Assessment Report

ATLANTIC OCEAN

Hurricane Georges In Puerto Rico

PUERTO RICO

**Observations,
Recommendations,
and Technical Guidance**

Inner Eye

Federal Emergency Management Agency
Mitigation Directorate
Washington, DC,
Region II, New York, NY
and the Caribbean Area Office





Table of Contents

List of Acronyms	ix
1 Executive Summary.....	1-1
2 Introduction	2-1
2.1 Background of Storm	2-1
2.2 Team Composition	2-3
2.3 Methodology	2-4
2.4 Planning Regulations	2-4
2.5 Floodplain Management Regulations	2-7
2.6 Puerto Rico Seismicity	2-7
3 Assessment and Characterization of Damages	3-1
3.1 Wind Effects	3-1
3.2 Riverine and Coastal Flooding	3-2
3.3 Landslides	3-8
3.4 Overview of Buildings Evaluated	3-10
3.4.1 Concrete/Masonry Structures with Concrete Roof Decks	3-10
3.4.2 Concrete/Masonry Structures with Wood-Frame Roof Structures	3-12
3.4.3 Combination Structures, Concrete/Masonry and Wood-Frame Structures	3-13
3.4.4 All Wood-Frame Structures	3-15
4 Structural Performance.....	4-1
4.1 Reinforced Concrete.....	4-4
4.1.1 Reinforced Concrete Mid- and High-Rise Buildings	4-4
4.1.2 Reinforced Concrete Essential Facilities	4-5
4.1.3 Concrete/Masonry Structures with Concrete Roof Decks	4-5
4.2 Masonry.....	4-6
4.2.1 Masonry Commercial Buildings	4-6
4.2.2 Residential Concrete/Masonry Structures with Wood-Frame Roof Structures	4-9
4.3 Wood-Frame Buildings.....	4-10
4.3.1 Commercial Wood-Frame Buildings	4-10
4.3.2 Residential Wood-Frame Buildings	4-10
4.3.2.1 Residential Wood-Frame Walls	4-11
4.3.2.2 Residential Wood-Frame Roof Structures	4-13
4.3.2.3 Residential Wood-Frame Floor Systems and Foundation Connections	4-14

4.4	Hold-Down Cables	4-16
4.5	Structural Seismic Considerations	4-17
5	Building Envelope Performance	5-1
5.1	Doors	5-1
5.1.1	Glass Doors	5-1
5.1.2	Personnel Doors	5-3
5.1.3	Security Grilles, Rolling (Overhead) and Garage Doors	5-4
5.2	Non-Load Bearing Walls, Wall Coverings, and Soffits	5-5
5.2.1	Non-Load Bearing Walls and Soffits	5-6
5.2.2	Wall Coverings	5-8
5.3	Roof Coverings	5-11
5.3.1	Metal Panels	5-11
5.3.2	Exposed Concrete and Liquid-Applied Membranes Over Concrete	5-14
5.3.3	Tile	5-15
5.3.4	Liquid-Applied Membranes Over Plywood	5-16
5.3.5	Built-Up Membranes	5-16
5.3.6	Sprayed Polyurethane Foam	5-18
5.3.7	Other Roof Coverings	5-18
5.4	Windows, Shutters, and Skylights	5-18
5.4.1	Windows	5-19
5.4.2	Shutters	5-23
5.4.3	Skylights	5-28
5.5	Seismic Resistance of Nonstructural Elements	5-28
6	Exterior Mechanical and Electrical Equipment	6-1
7	Electrical Distribution System	7-1
8	Conclusions	8-1
8.1	General Conclusions	8-1
8.1.1	Mitigation Efforts	8-2
8.1.2	Wind Mitigation for Existing Buildings	8-4
8.2	Planning Regulations in Puerto Rico	8-4
8.2.1	Wind Provisions of Planning Regulation 7	8-5
8.2.2	Seismic Provisions of Planning Regulation 7	8-5
8.2.3	Floodplain Management Provisions of Planning Regulation 13	8-6
8.3	Regulatory Administration and Enforcement	8-6
8.4	Training and Continuing Education	8-7
8.4.1	Government of Puerto Rico Personnel	8-7
8.4.2	Design Professionals and Building Contractors	8-7
8.5	Structural	8-7
8.5.1	Structural Seismic Conclusions	8-8
8.6	Architectural	8-8
8.6.1	Doors	8-9
8.6.2	Walls	8-9
8.6.3	Roof Coverings	8-9
8.6.4	Glazing	8-9
8.6.5	Shutter Systems and Impact-Resistant Glazing	8-10
8.6.6	Weatherstripping	8-10

8.6.7	Seismic Resistance of Nonstructural Elements	8-10
8.7	Exterior Mechanical and Electrical Equipment	8-10
9	Recommendations	9-1
9.1	General Recommendations	9-1
9.2	Training and Continuing Education	9-2
9.2.1	Government of Puerto Rico Personnel	9-2
9.2.2	Design Professionals and Building Contractors	9-2
9.3	Codes and Regulations	9-3
9.3.1	Planning Regulation 7	9-3
9.3.2	Floodplain Management Provisions of Planning Regulation 13	9-4
9.3.3	Evaluation, Submittals, and Product Approval	9-5
9.4	Essential Facilities	9-5
9.5	Residential Buildings	9-5
9.6	Structural and Architectural Performance	9-5
9.7	Electric Power Distribution	9-6
10	References	10-1
 Appendix A: Members of the Building Performance Assessment Team for Hurricane Georges		
 Appendix B: Presidential Disaster Declarations In Puerto Rico		
Acknowledgments		

List of Figures and Tables

Figure 2-1	History of hurricanes in Puerto Rico.	2-2
Table 2-1	The Saffir-Simpson Scale	2-3
Figure 2-2	Flyover routes from October 2 and October 3.	2-5
Figure 2-3	Locations of ground investigation by the BPAT.	2-6
Figure 3-1	The abrupt change of topography in this community outside Loiza caused a speedup in the wind that flows over and around the buildings located on the hill beyond.	3-2
Figure 3-2	Wind damage from Hurricane Georges to residential buildings in Puerto Rico.	3-2
Figure 3-3	Typical non-elevated structures in a community located entirely in an SFHA.	3-3
Figure 3-4	This flood gate located in Adjuntas prevented backwater from flooding homes located behind it.	3-3
Figure 3-5	Residential area on the opposite side of the river from the floodwall in Figure 3-4.	3-4
Figure 3-6	Floodwaters eroded soil and undermined the foundation system of this building.	3-4
Figure 3-7	Riverbank erosion resulted in the undermining of the building foundations of a school and house in Jayuya.	3-5
Figure 3-8	Typical construction adjacent to and over the river.	3-5
Figure 3-9	Structure along the coast damaged by storm surge and wave action.	3-6
Figure 3-10	Proper elevation construction techniques for construction in A-Zones.	3-6
Figure 3-11	Comparison of building foundation and elevation requirements in V-Zones and A-Zones.	3-7
Figure 3-12	Bridge outside Adjuntas collapsed due to insufficient design to resist the effects of floodwaters.	3-7
Figure 3-13	Severely damaged water treatment facility located in the floodplain in Jayuya.	3-8
Figure 3-14	Aerial view of a now uninhabitable house caught in a landslide.	3-8
Figure 3-15	A landslide inundated this house with up to 5 feet of soil.	3-9
Figure 3-16	Development adjacent to a representative unprotected cut; the potential for future landslide activity exists.	3-9
Figure 3-17	Commercial concrete structures with no structural damage.	3-10
Figure 3-18	Commercial concrete structure with interior damage observed due to breach of building envelope.	3-11
Figure 3-19	Residential concrete structure in the mountains north of Adjuntas with no structural damage following Hurricane Georges.	3-12
Figure 3-20	Aerial view of a residential concrete/masonry structure with a wood-frame roof structure.	3-13
Figure 3-21	A combination residential concrete/masonry structure with an elevated second-floor concrete slab and a wood-framed upper level.	3-14
Figure 3-22	A residential concrete/masonry structure under construction.	3-14
Figure 3-23	A residential wood structure located on the hilltops west of Ponce destroyed by wind.	3-15

Figure 4-1	Illustration of continuous load path for a wood-frame building.	4-2
Figure 4-2	A residential community constructed of concrete and masonry buildings with concrete roof structures.	4-3
Figure 4-3	A residential community constructed of wood-frame structures only.	4-3
Figure 4-4	Concrete residential structure with foundation damage caused by a landslide.	4-4
Figure 4-5	Fire station in Adjuntas.	4-5
Figure 4-6	Residential home constructed of reinforced concrete and masonry with a reinforced concrete roof deck in the mountains outside Adjuntas.	4-6
Figure 4-7	Typical roof system failure between wooden roof system and concrete or masonry wall system.	4-7
Figure 4-8	Termite-damaged wood purlin attached to metal roof panel.	4-7
Figure 4-9	Masonry church that lost roof purlins and its corrugated metal roof.	4-8
Figure 4-10	Nailed roof structure from church in Figure 4-9.	4-8
Figure 4-11	Typical nail withdrawal failure in a wood-frame structure supported by a masonry wall with little uplift capacity at the connection.	4-9
Figure 4-12	Hurricane clips installed in a wood-frame house on Culebra.	4-10
Figure 4-13	Example of the failure of wood member in joist hanger due to use of improper nails.	4-11
Figure 4-14	Example of wood-frame wall construction that failed during Hurricane Georges.	4-12
Figure 4-15	Wood wall column that failed at connection to sill plate.	4-12
Figure 4-16	Typical wooden roof structure with metal roof panels above.	4-13
Figure 4-17	Example of a self-built, wooden roof truss.	4-14
Figure 4-18	Example of a non-engineered connection between the building foundation and the floor system.	4-14
Figure 4-19	Example of an engineered connection between the floor beam and a concrete column.	4-15
Figure 4-20	Example of a successful wood connection between support beam and floor joists.	4-15
Figure 4-21	Wood-frame house with metal roof covering with hold-down cables that run parallel and perpendicular to the roof ridge line.	4-16
Figure 4-22	Residential building supported atop tall, unbraced columns.	4-17
Figure 4-23	Footing for tall columns shown in Figure 4-22.	4-18
Figure 5-1	Damaged sliding glass door and window assembly in a hotel room.	5-2
Figure 5-2	Missiles broke this wood/glass door and several adjacent window panes.	5-2
Figure 5-3	A missile traveling right to left struck the window louvers.	5-3
Figure 5-4	The security grille on this fire station offers greater wind performance reliability than a solid door.	5-4
Figure 5-5	The gypsum wallboard was blown off of this interior partition after the exterior non-load bearing wall was blown away.	5-5
Figure 5-6	Rain entered this hospital on Culebra after a water tank struck the metal wall panels.	5-6

Figure 5-7	Failure of an EIFS wall system.	5-7
Figure 5-8	Several composite panels blew off from the fascia and soffit of this building at the airport on Isla Grande.	5-7
Figure 5-9	The stucco was blown off the corner area of this wall where the suction pressures were high.	5-8
Figure 5-10	House currently under construction.	5-9
Figure 5-11	In this EIFS covering, the synthetic stucco appeared to be well-adhered to the outer EPS layer, but there was minimal bonding between the two EPS layers.	5-10
Figure 5-12	A mortar skim coat was applied over the concrete of this building and the ceramic tiles were set in to the mortar.	5-10
Figure 5-13	This house was located on a mountain top that experienced very high wind conditions.	5-11
Figure 5-14	The nail attaching this corrugated metal panel partially backed-out.	5-12
Figure 5-15	Only a single row of fasteners were installed along the eave and each side of the ridge.	5-12
Figure 5-16	The metal panels along this rake were insufficiently fastened.	5-13
Figure 5-17	At this house, a framing member was run up the rake, which allowed the metal purlins to be fastened between the nailers (purlins).	5-13
Figure 5-18	Corrugated metal panel wrapped around a power pole.	5-14
Figure 5-19	This concrete roof deck did not have a roof covering.	5-15
Figure 5-20	These tiles were heavily damaged, although the wind speed at this location was not very high.	5-15
Figure 5-21	This house had a liquid-applied membrane over plywood roof sheathing.	5-16
Figure 5-22	This built-up membrane had a mineral surface cap sheet.	5-17
Figure 5-23	The windows in this building were broken by aggregate from the built-up roof of a nearby building.	5-17
Figure 5-24	When these tempered panes broke, they did not produce shards of glass, as did the annealed panes.	5-19
Figure 5-25	Although some annealed panes broke into shards, others just broke at the impact point.	5-19
Figure 5-26	Half of the window frame on this building was blown out.	5-20
Figure 5-27	One pane in the window was broken by a missile, perhaps from the palm in the foreground.	5-20
Figure 5-28	This large window was broken by a missile, most likely a tree limb.	5-21
Figure 5-29	The glass and frames were blown out at the center room on the top floor.	5-21
Figure 5-30	Several window and glass door openings broke during the hurricane.	5-22
Figure 5-31	High-energy missiles from a nearby building damaged several railings of this building.	5-22
Figure 5-32	The broken light in the center is laminated.	5-23
Figure 5-33	A combination of boards and metal panel was used to construct this shutter.	5-24
Figure 5-34	These windows were equipped with permanent head and sill shutter tracks, which were attached to the wall with closely-spaced fasteners.	5-24

Figure 5-35	Close-up of Figure 5-34.	5-25
Figure 5-36	Looking up at a shutter panel held in place by clips.	5-25
Figure 5-37	These windows were equipped with roll-up shutters.	5-26
Figure 5-38	This house had hinged plywood shutters.	5-26
Figure 5-39	Steel shutters were used on this mid-rise building, which had a narrow balcony in front of the windows.	5-27
Figure 5-40	The window lying on the ground was protected by a shutter.	5-27
Figure 5-41	Lack of seismic resistance of ceiling lights and ducts.	5-28
Figure 5-42	Inadequately reinforced CMU partition in house under construction.	5-29
Figure 6-1	This exhaust fan lost its cowl.	6-1
Figure 6-2	Most of the solar hot water heaters on this roof successfully weathered Hurricane Georges.	6-2
Figure 6-3	Floodwater entered this generator room and reached a height of about 2 feet.	6-2
Figure 6-4	This service mast is mounted on a concrete pylon.	6-3
Figure 7-1	Damaged wood pole.	7-2
Figure 7-2	Leaning wood pole due to inadequate pile embedment.	7-2
Figure 7-3	Observed crack in concrete pole that appears to be a quality control problem.	7-3
Figure 7-4	New wood pole replaced after the hurricane.	7-3
Figure 8-1	Comparison of undamaged concrete/masonry buildings with damaged wood-frame building.	8-2
Figure 8-2	Wood-frame house nearly totally destroyed.	8-3
Figure 8-3	Example of successful mitigation of wood-frame house.	8-3
Figure 9-1	Successes and failures in residential buildings after Hurricane Georges.	9-2
Table 9-1	Probability of experiencing different events during specified yearly periods.	9-6



List of Acronyms

A-Zone	Special Flood Hazard Areas, excluding V-Zones
ACI	American Concrete Institute
AISC	American Institute of Steel Construction
ARPE	Administración de Reglamentos y Permisos (Regulations and Permits Administration)
ASCE 7-95	American Society of Civil Engineers Standard 7-95 <i>Minimum Design Loads for Buildings and Other Structures</i>
ASD	Allowable Stress Design
ASOS	Automatic Surface Observing System
ASTM	American Society for Testing and Materials
BFE	Base Flood Elevation
BOCA	Building Officials and Code Administrators
BPAT	Building Performance Assessment Team
CAV	Community Assessment Visit
CIAPR	Colegio de Ingenieros y Agrimensores (College of Engineers and Surveyors)
CMU	Concrete Masonry Unit
EIFS	Exterior Insulating Finishing System
EO12699	Executive Order 12699
EO11988	Executive Order 11988
EPS	Expanded Polystyrene System
FEMA	Federal Emergency Management Agency
FIRM	Flood Insurance Rate Map
HVAC	Heating, Ventilation, and Air Conditioning
IBC	International Building Code
ICBO	International Conference of Building Officials
in	inch
LRFD	Load and Resistance Factor Design
mb	millibars
mph	miles per hour
NEHRP	National Earthquake Hazards Reduction Program

LIST OF ACRONYMS

NFIP	National Flood Insurance Program
NOAA	National Oceanic and Atmospheric Administration
NWS	National Weather Service
psf	pounds per square foot
SBC	Standard Building Code
SBCCI	Southern Building Code Congress International
SFHA	Special Flood Hazard Area
UBC	Uniform Building Code
V-Zone	An area of special flood hazard extending from offshore to the inland limit of a primary frontal dune along an open coast and any other area subject to high velocity wave action from storms or seismic sources